FM STEREO/FM-AM RECEIVER

STR-6065

USA Model

SUPPLEMENT

No. 2
April, 1973

This supplement updates the service manual to include the production changes.
File the supplement with the service manual.

The power amplifier board has been modified because transistors, Q709 and Q759, in driver stage, changed from 2SA527 to 2SA653.

CHANGED PARTS

Ref. No.	*Former Part No./Value*	*New Part No./Value*	*Remarks*
Q709 (Q759)	transistor, 2SA527	2SA653	changed
C712 (C762)	1-105-679-12 0.033 ±10% 50V mylar	----------	deleted
C715 (C716)	----------	1-105-503-12 0.0015 ±5% 200V mylar	added
R733 (R783)	1-242-619 5.6 ±5% ¼W carbon	1-242-629-11 15 ±5% ¼W carbon	changed
R741 (R791)	1-202-525 10 ±5% ½W composition	----------	deleted
R745 (R795)	----------	1-244-637-11 33 ±5% ¼W carbon	added

SCHEMATIC DIAGRAM

: changed portion

POWER AMP SECTION

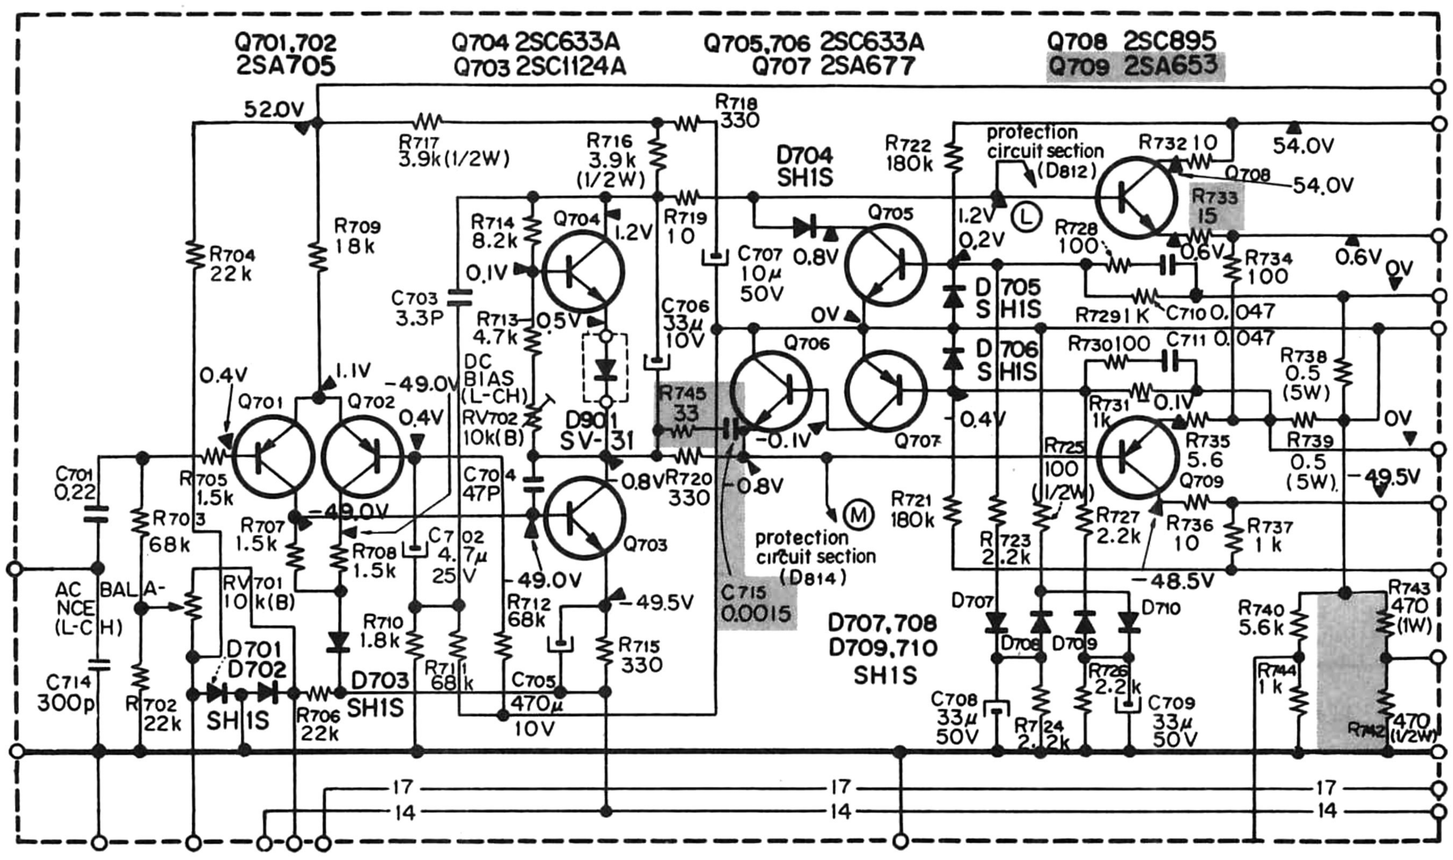

SONY®
SERVICE MANUAL

MOUNTING DIAGRAM — Power Amplifier Board —

— Conductor Side —

: changed portion

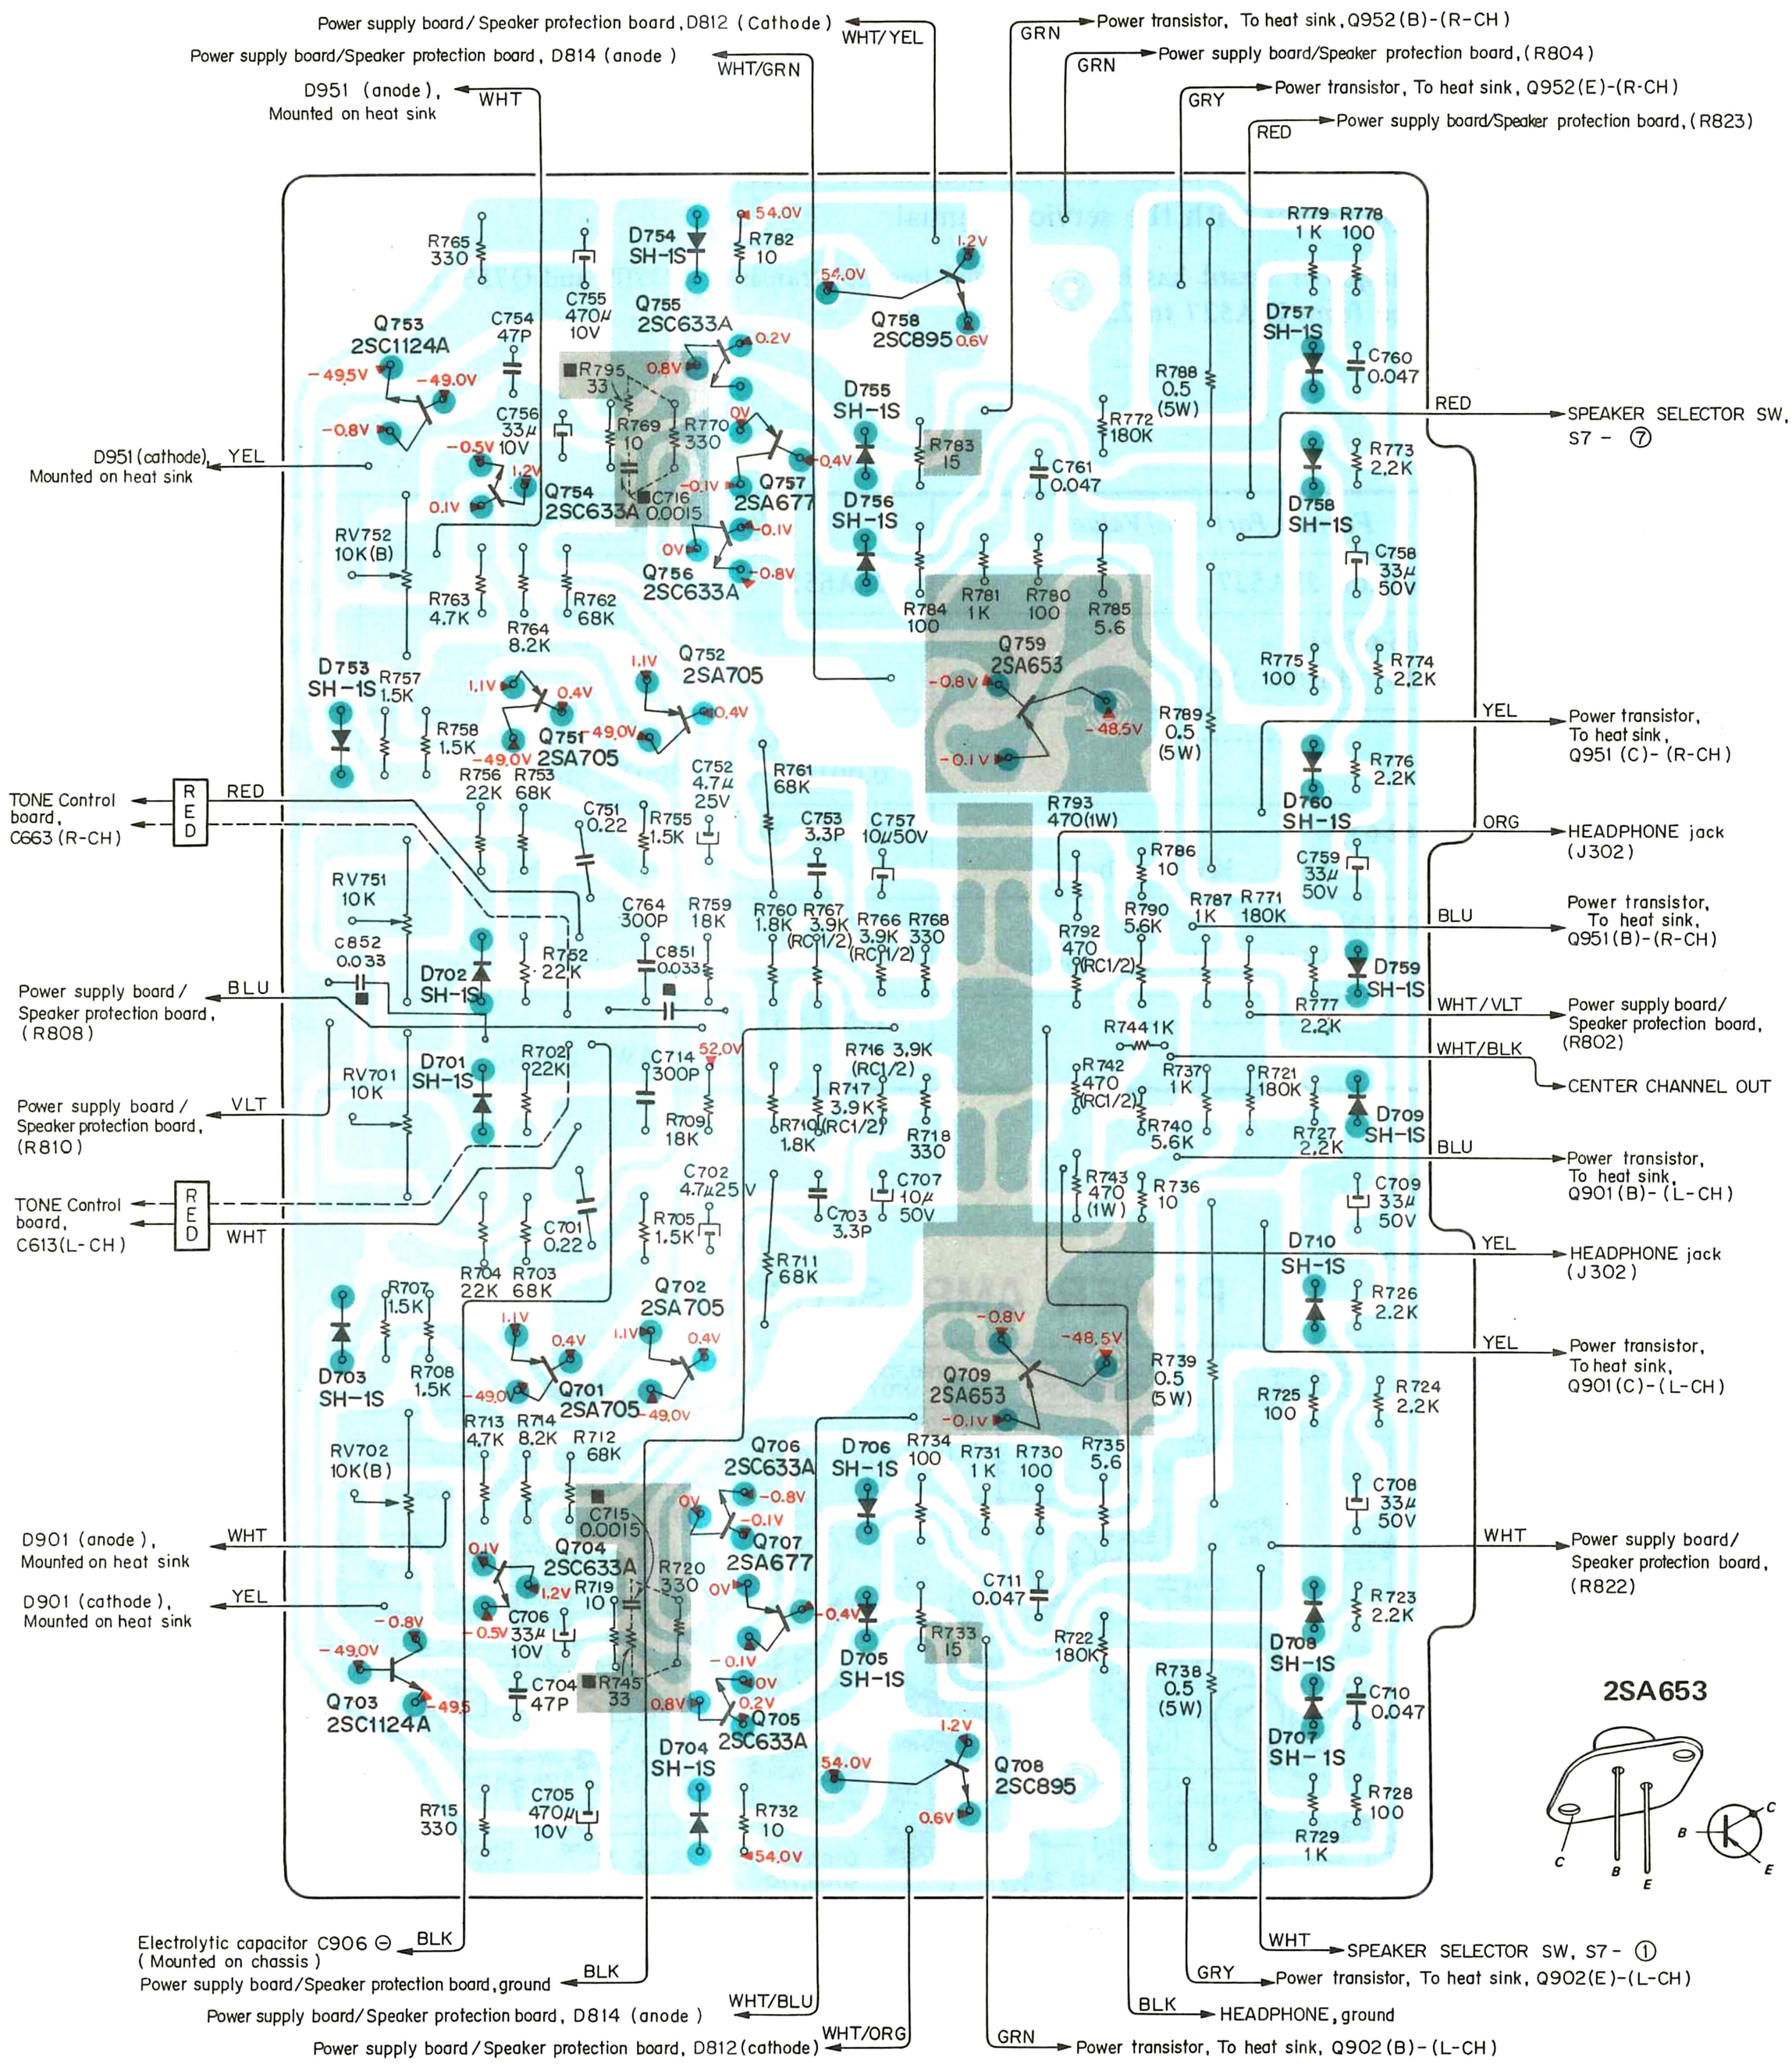

Note: ■ mounted on conductor side

SONY CORPORATION

© 1973

3D0619-1

Printed in Japan