
Service Bulletin

Harman/Kardon Incorporated
55 Ames Court
Plainview, N.Y. 11803
(516) 681-4000

SERVICE BULLETIN #170

NOVEMBER 1974

TO: ALL AUTHORIZED WARRANTY STATIONS
FROM: LEN GAYNOR, NATIONAL SERVICE MANAGER
SUBJECT: MULTIPLEX CHIP, MODEL 330B

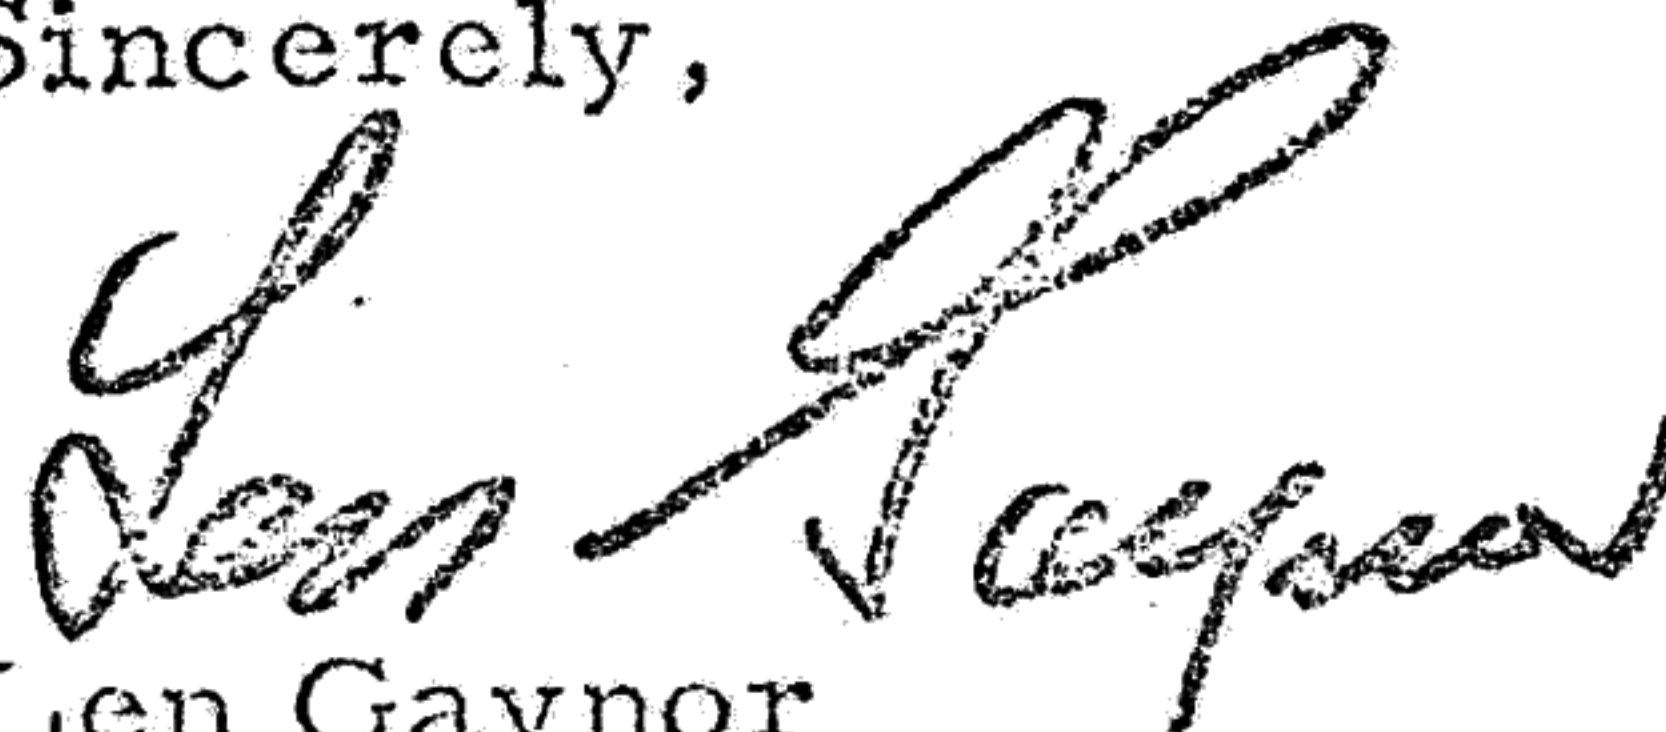
As indicated in your technical material, all Model 330B's with Serial Numbers 1001 through 16885 used a Multiplex Chip #MC1307, H/K Part #43126551.

All Model 330B's with Serial Numbers 16686 and higher used a Multiplex Chip #BA1310, H/K Part #43130555. Please correct your records in the Technical Manual to change this number to BA1310, H/K Part #43128071.

If this BA1310 Multiplex Chip requires replacement, please order H/K Part #43128071 and also check the associated circuitry on the copper side of the Multiplex Board. If there is a resistor (either 470k or 680k) from Pin #2 of the chip to ground, leave resistor in circuit when replacing the chip.

If there is no resistor, ADD a 680k from Pin 2 to Ground on the copper side of the board.

Sincerely,


Len Gaynor
National Service Manager